

Page 1 of 4 Test Report No.: 19301152 003 Seite 1 von 4 Prüfbericht - Nr.: **Electrical Safety Office** Client: Level 16, 50 Ann Street, Brisbane, Queensland, Australia, QLD 4001 Auftraggeber: Test item: V-90 PVC insulated and PVC sheathed cable Gegenstand der Prüfung: Identification: Serial No.: No Serial Number Refer to page 2 Serien-Nr.: Bezeichnung: Date of receipt: Receipt No.: 24/10/2013 1113006481 Eingangsdatum: Wareneingangs-Nr.: Condition of test item at delivery: Market sourced samples supplied by client Zustand des Prüfgegenstandes bei Anlieferung: TÜV Rheinland Australia Pty. Ltd. Testing location: 182 Dougharty Road, Heidelberg West, Australia VIC 3081 Prüfort: AS/NZS 3808:2000 including amendment 2 Test specification: Insulating and sheathing materials for electric cables Prüfgrundlage: The test item failed the test specifications. Test Result: Der vorstehend beschriebene Prüfgegenstand wurde geprüft und entspricht nicht Prüfergebnis: oben genannter Prüfgrundlage. Testing Laboratory/ TÜV Rheinland Australia Pty. Ltd. 182 Dougharty Road, Heidelberg West, Australia VIC 3081 Prüflaboratorium: Reviewed by/kontrolliert: Compiled by/ zusammengestellt: 20/01/2014 Istvan SZECSEI 20/01/2014 Gergo BOGDAN Name/Stellung Unterschrift Datum Name/Stellung Unterschrift Datum Name/Position Signature Date

Other Aspects/ Sonstiges:

Date

As per client's request test procedure was limited to tensile strength and elongation measurement of unaged and aged samples.

entspricht Prüfgrundlage Abkürzungen: P(ass) F(ail)

N/A

N/I

Name/Position

entspricht nicht Prüfgrundlage

Signature

nicht getestet

nicht anwendbar

Abbreviations:

P(ass) passed failed

F(ail) N/A

not applicable not tested

This test report relates to the a. m. test sample. Without permission of the test center this test report is not permitted to be duplicated in extracts. This test report does not entitle to carry any safety mark on this or similar products.

Dieser Prüfbericht bezieht sich nur auf das o.g. Prüfmuster und darf ohne Genehmigung der Prüfstelle nicht auszugsweise vervielfältigt werden. Dieser Bericht berechtigt nicht zur Verwendung eines Prüfzeichens.

Revision 5.0

Accredited for compliance with ISO/IEC 17025 **Technical Competence**





Test Report No.: 19301152 003

Page 2 of 4



Test Report

AS/NZS 3808:2000 including amendment 2
Insulating and sheathing materials for electric cables

Test item particulars:

Test item is a V-90 PVC insulated 5V-90 PVC sheathed cable.

General remarks:

- 1. This report shall not be reproduced, except in full.
- 2. Details in test data / test plan no. 1113006481
- 3. Specification applied:

AS/NZS 3808:2000 inc. amendment 2


AS/NZS 1660.2.1:1998 inc. amendment 1

AS/NZS 1660.2.3:1998 inc. amendment 1

- 4. Reporting of results herein is in accordance with NATA recommendations taking into account U of M. (a) For minimum limits - Where measurement is on the limit or above the limit it is deemed to comply. Where measurement is below the limit it is deemed not to comply.
 - (b) For maximum limits Where measurement is on the limit or below the limit it is deemed to comply. Where measurement is above the limit it is deemed not to comply.
- 5. For reporting of results the estimated uncertainty for measurement taken into account at 95% confidence level.
- 6. This test report is based on assessment and tests applied to the specific test item(s) as submitted by the client. TÜV Rheinland Australia disclaims any and all responsibility or obligation for any other item.
- 7. Test procedure limited to Table 5 items A and B, Table 6 items A and B of AS/NZS 3808.
- Due to the ageing treatment test samples became so rigid and brittle that they cannot be mounted into the machine for testing, therefore they failed the standard specifications and unaged samples were not measured.

Markings on cable:

"INFINITY CABLE 2012 V-90 ELECTRIC CABLE 450/750V AS/NZS5000.2 6mm² x2C+E CU/PVC/PVC "

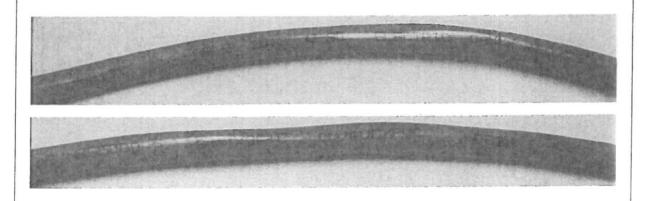

Options/accessories/ancillary equipment:

The equipment was tested without any optional accessory installed. Hence, this report does not cover parameters that are influenced by the installation of optional accessory that might affect safety in the meaning of this standard.

Test Report No.: 19301152 003

Page 3 of 4



AS/NZS 3808:2000 inc. amendment 2					
Clause	Requirement + Test	Result - Remark	Verdict		


4	Materials		
4.1	Insulating material type	V-90	#6. -/12.5
4.2	Sheathing material type	5V-90	
5	Tests and criteria		4.0
	The properties of materials are specified in the following tables:		
	Requirements applicable for Insulating material:	Table 5	
	Requirements applicable for Sheathing material:	Table 6	• 1
Table 5	Tests and criteria for insulation		F
Α	Mechanical tests without ageing:	Not tested due to obvious fail after ageing	N/T
A.1	Tensile strength - min. 12.5 MPa		N/T
A.2	Elongation at rupture - min. 150%		N/T
В	Mechanical tests after ageing in air oven: 504 h at 115 ± 2 °C	Aged samples were rigid and brittle, unable to measure	F
B.1	Tensile strength - min. 75% of value of unaged specimens		F
B.2	Elongation at break - min. 65% of value of unaged specimens		F
Table 6	Tests and criteria for sheath		F
A	Mechanical tests without ageing:	Not tested due to obvious fail after ageing	N/T
A.1	Tensile strength - min. 12.5 MPa		N/T
A.2	Elongation at rupture - min. 150%		N/T
В	Mechanical tests after ageing in air oven: 504 h at 115 ± 2 °C	Aged samples were rigid and brittle, unable to measure	F
3.1	Tensile strength - min. 75% of value of unaged specimens		F
3.2	Elongation at break - min. 65% of value of unaged specimens		F


Test Report No.: 19301152 003

Page 4 of 4



PHOTOS

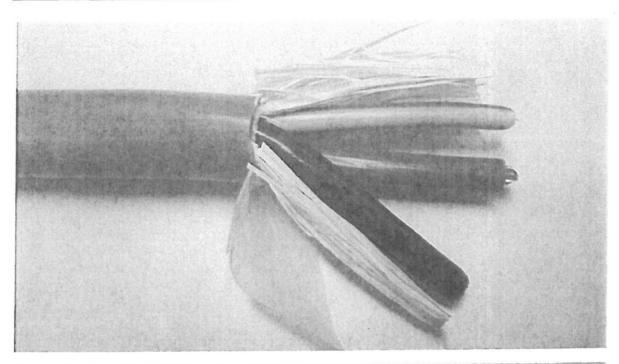

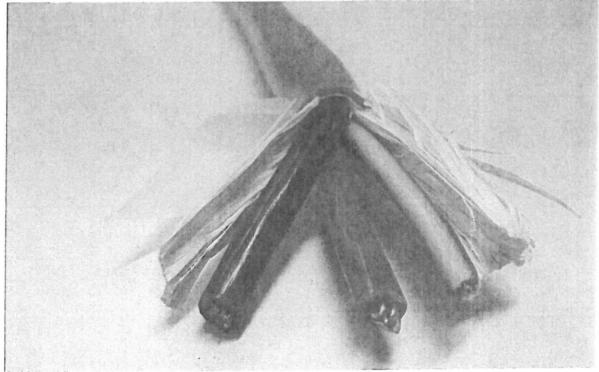

End of the Test report